









GW Instek rolls out the new PCS-10001 isolated output high precision current shunt meter, which inherits the simultaneous voltage and current measurement function of PCS-1000. PCS-10001 adopts five sets of independent shunt resistors to provide five current measurement levels, including 300A, 30A, 3A, 300mA, and 30mA to meet the requirements of different current level measurements. Internally, PCS-10001 utilizes two sets of 24bits ADCs and low temperature coefficient electronic components to mainly focus on the current measurement of power supply devices. High precision PCS-10001 can be used in adjusting and calibrating instruments. Additionally, temperature variation will not cause PCS-10001 to yield any measurement errors. PCS-10001 can automatically select optimal measurement level with the maximum resolution so as to replace manual selection to save operational time.

PCS-1000I provides a BNC output, which can connect with an oscilloscope to directly observe current waveform variation without using a current probe. General oscilloscopes do not have isolated channels and their input and output are structured at a common point, therefore, the output load will likely result in measurement errors. PCS-1000I's isolated current output design can prevent measurement errors from an oscilloscope with non-isolated outputs. PCS-1000I, a high precision AC/DC current shunt meter, not only provides USB and GPIB communications interfaces for users to remotely control the instrument but also conducts simultaneous voltage and current measurements. The SCPI communications commands of PCS-1000I allow users to remotely control PCS-1000I via a PC to operate measurement data readbacks.



PCS-1000I high precision AC and DC shunt meter can simultaneously measure current and voltage with the maximum 6 1/2 measurement resolution. The above diagram shows the connection method of simultaneous measurement. Compared with the test of conventional meters from other brands, PCS-1000I is simple in connection and there is no requirement of any additional instrument.

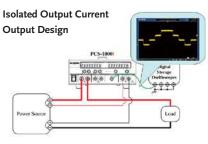


PCS-1000I adopts isolated current output design. Its BNC output can directly connect with an oscilloscope to avoid measurement errors resulted from the common ground of oscilloscope's analog input measurement.

#### **Connection Comparison**


PCS-1000I can simultaneously measure current and voltage with 6 1/2 measurement resolution. The below diagram shows the connection method of simultaneous measurement. Compared with the test of conventional meters from other brands, PCS-1000I is simple in connection and there is no requirement of any additional instrument.

# PCS-1000I Conducts Simultaneous Voltage and Current Measurement




- Only one PCS-1000I is needed to measure voltage and current
- 2. Easy connection
- 3.USB and GPIB communications on the rear panel can be used for data communication while connecting with a PC

#### Shunt Resistor Conducts Current and Voltage Measurement



- One voltage meter is needed to measure voltage on shunt and the voltage will be converted to current.
   For simultaneous voltage and current measurement, one extra voltage meter is required
- 2.Complex connection
- For data communication with a PC, the PC must be connected to two voltage meters

# Conventional Shunt Meter Conducts Current and Voltage Measurement

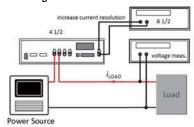

- 1.This method requires one shunt meter, one current meter to increase current measurement resolution, and one voltage meter to measure voltage
- 2.Complex connection
- For data communication with a PC, the PC must be connected to two meters

## **PCS-1000I**

#### **FEATURES**

- 6 1/2 Digit Voltage and Current Measurement Resolution
- Simultaneous Current and Voltage Measurement
- Five Current Measurement Levels(AC & DC): 30mA/300mA/3A/30A/300A
- AC Voltage Measurement Levels : 200mV/2V/20V/200V/600V
- DC Voltage Measurement Levels : 200mV/2V/20V/200V/1000V
- Standard: USB & GPIB
- CE Verification



Front Panel



Rear Panel



PCS-1000I vs. Current Probe for Measurement

## **APPLICATIONS**

- Power Supply Analysis
- Power Supply Measurement Application
- R & D and Laboratory Application
- Quality Inspection Test
- Precision Measurement



#### **SPECIFICATIONS DC Voltage** 1 Year 23 °C ± 5 °C Temperature Coefficient/°C Range **CHARACTERISTICS** 200.0000 mV 0.0050 + 0.00350.0005 + 0.00050.0005 + 0.0001 2.000000 V 0.0050 + 0.001020.00000 V 0.0005 + 0.0001 0.0050 + 0.0010200.0000 V 0.0050 + 0.00100.0005 + 0.00011000.000 V 0.0050 + 0.00200.0005 + 0.0001Accuracy specification: $\pm$ (% of reading + % of range); voltage input resistance: $10M\Omega$ for all DC voltage ranges **DC** Current Burden Voltage 1 Year 23 °C ± 5 °C Temperature Coefficient/°C Range 0.01 + 0.0050.001 + 0.002 30,00000 mA < 0.4 V0.01 + 0.0050.001 + 0.002300,0000 mA < 0.5 V 0.01 + 0.005 3.000000 A 0.001 + 0.002< 0.8 V 0.01 + 0.0050.001 + 0.00230,00000 A\*1 < 0.8 V 300,0000 A\*1 0.02 + 0.0050.001 + 0.002< 0.8 V Accuracy specification: $\pm$ (% of reading + % of range) Temperature Coefficient/°C **Isolated DC Current** Resolution (61/2)DC Accuracy Range **Monitor Accuracy** 0.1 + 0.0530,00000 mA 0.00001mA 0.001 0.1 + 0.050.001 300,0000 mA 0.0001mA 3 000000 A 0.00001A 0.1 + 0.050.001 0.1 + 0.050.001 30,00000 A\*1 0.00001A 300.0000 A\*1 0.0001A 0.2 + 0.050.001 Accuracy specification: $\pm$ (% of output + % of full scale);monitor output voltage for the full scale current = 3V AC True RMS AC Voltage Temperature Coefficient/°C Frequency 1 Year 23 °C ± 5 °C Range **CHARACTERISTICS** 0.005 + 0.005200,0000 mV 0.5 + 0.050.005 + 0.0052.000000 V 45Hz~2kHz 20.00000 V 2kHz~10kHz 1.0 + 0.050.005 + 0.0052.0 + 0.100.005 + 0.00510kHz~20kHz 200.0000 V 0.005 + 0.005600,000 V Accuracy specification: $\pm$ (% of reading + % of range) True RMS AC Current Temperature Coefficient/°C Range Frequency 1 Year 23 °C ± 5 °C 30,00000 mA 0.03 + 0.0060.5 + 0.0545Hz~2kHz 0.03 + 0.006300,0000 mA 2kHz~10kHz 1.0 + 0.050.03 + 0.0063.000000 A 30.00000 A\*1 0.03 + 0.00645Hz~400Hz 0.5 + 0.050.03 + 0.006300,0000 A\*1 Accuracy specification: ±(% of reading + % of range) **Isolated AC Current AC** Accuracy Temperature Coefficient/°C Frequency Range **Monitor Accuracy** 30.0000 mA 0.001 0.2 + 0.0545Hz~2kHz 300,0000 mA 0.001 2kHz~10kHz 0.5 + 0.053.000000 A 0.001 30,00000 A\*1 0.001 45Hz~400Hz 0.5 + 0.05300.0000 A\*1 0.001 Accuracy specification: $\pm$ (% of output + % of full scale); monitor output voltage for the full scale current = 3V; The specifications are only applicable when the input is 10% or greater of the full scale range **GENERAL Power Supply** 100 V/120 V/220 V/240 V ±10%

Power Supply
Power Line Frequency
Operating Environment
Storage Environment
Power Consumption
Dimensions Weight

50/60 Hz

Full accuracy for 0  $^{\circ}\text{C}$   $\sim$  55  $^{\circ}\text{C}$  , Full accuracy to 80% R.H. at 40  $^{\circ}\text{C}$ 

-40 °C ~ 70 °C Max 35VA

210(W) x 80(H) x 390(D)mm; Approx. 5 kg

(The specifications apply when the PCS-1000I is powered on for at least 30 minutes to warm-up to a temperature of 18 °C ~ 28 °C, unless specified otherwise.)

Note: \*1 The accuracy for 30A/300A levels must be increased by a power factor of 8 ppm/watt.

Specifications subject to or Specifications subject s

 Jote: \*1 The accuracy for 30A/300A levels must be increased by a power factor of 8 ppm/watt.
 Specifications subject to change without notice.

 ORDERING INFORMATION
 OPTIONAL ASSESSORIES

PCS-10001 Isolated Output High Precision Current Shunt Meter

Quick Operation Guide, User Manual (CD) x 1, AC Power Cord x 1 (Region Dependant),

GTL-105A Alligator Clip Test Lead (3A Max)
GTL-207 Banana Plug Test Lead

GTL-240 USB Cable
PCS-001 Basic Accessory Kit

CRA 410 L Book Mount Adon

GRA-419-J Rack Mount Adapter (JIS)
GRA-419-E Rack Mount Adapter (EIA)

Global Headquarters

## GOOD WILL INSTRUMENT CO., LTD.

No.7-1, Jhongsing Road, Tucheng Dist., New Taipei City 236, Taiwan T +886-2-2268-0389 F +886-2-2268-0639 E-mail: marketing@goodwill.com.tw

China Subsidiary

### GOOD WILL INSTRUMENT (SUZHOU) CO., LTD.

No. 521, Zhujiang Road, Snd, Suzhou Jiangsu 215011 China T+86-512-6661-7177 F+86-512-6661-7277 E-mail: marketing@instek.com.cn

Malaysia Subsidiary

#### GOOD WILL INSTRUMENT (M) SDN. BHD.

No. 1-3-18, Elit Avenue, Jalan Mayang Pasir 3, 11950 Bayan Baru, Penang, Malaysia T +604-6111122 F +604-6115225 E-mail: sales@goodwill.com.my

Europe Subsidiary

## GOOD WILL INSTRUMENT EURO B.V.

De Run 5427A, 5504DG Veldhoven, THE NETHERLANDS T +31 (0) 40-2557790  $\,$  F +31 (0) 40-2541194

U.S.A. Subsidiary

## INSTEK AMERICA CORP.

5198 Brooks Street Montclair, CA 91763, U.S.A. T +1-909-399-3535 F +1-909-399-0819 E-mail: sales@instekamerica.com

Japan Subsidiary

#### TEXIO TECHNOLOGY CORPORATION.

7F Towa Fudosan Shin Yokohama Bldg., 2-18-13 Shin Yokohama, Kohoku-ku, Yokohama, Kanagawa, 222-0033 Japan T +81-45-524-7181

E-mail: info@texio.co.jp

Korea Subsidiary

## GOOD WILL INSTRUMENT KOREA CO., LTD.

Room No.503, Gyeonginro 775 (Mullae-Dong 3Ga, Ace Hightech-City B/D 1Dong), Yeongduengpo-Gu, Seoul 150093, Korea. T +82-2-3439-2205 F +82-2-3439-2207

E-mail: gwinstek@gwinstek.co.kr







CS1000GD1DH

www.gwinstek.com

www.facebook.com/GWInstel